



dave  
nutting  
associates

a division of IBM manufacturing corporation

527 west golf road  
arlington heights,  
illinois 60005  
(312) 956-0710

---

August 20, 1979

Mr. Bob Fabris .  
3626 Morrie Dr.  
San Jose, CA 95127

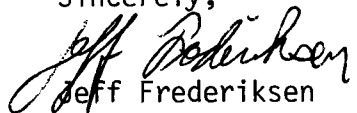
Dear Bob,

The enclosed assemblies replace the 75361 clock driver, located in the oscillator shield.

The failure of the 75361 is that the 6V high time after warm-up drops below 55ns causing the data chip to appear defective. If you do not have this shrinking clock syndrome, replacement is not necessary.

I hope you find the enclosed hardware description useful.

Sincerely,

  
Jeff Frederiksen